

Use of Mode Conditioning Patch Cables in Gigabit Ethernet and 10 Gigabit Ethernet Laser-Based Transmissions

PB530836

This bulletin describes the necessary steps to help ensure that Gigabit and 10 Gigabit Ethernet laser-based transmissions over multimode fiber (MMF) are successfully implemented and supported. It depicts the requirements for mode conditioning patch (MCP) cables.

Cisco Transceiver Modules and Mode Conditioning Patch cables

The transceiver modules affected by the requirement of MCP are described in Table 1.

Table 1. Optical Transceivers

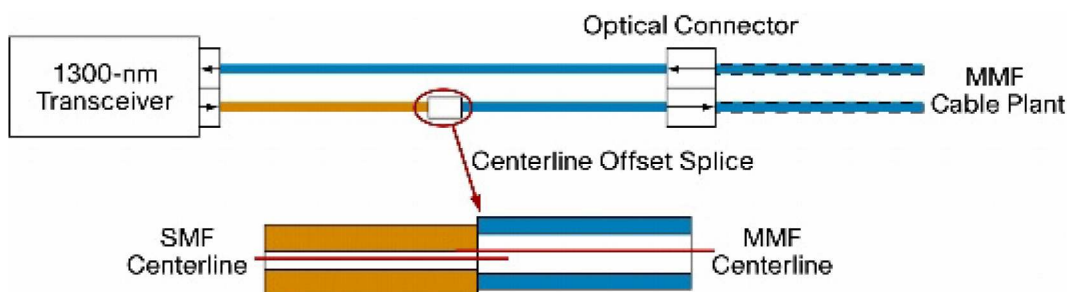
Product Number	Product Description
WS-G5486=	Cisco 1000BASE-LX/LH GBIC transceiver module for SMF and MMF, 1300-nm wavelength, commercial operating temperature range, 32°F to 158°F (0°C to 70°C)
GLC-LH-SM=	Cisco 1000BASE-LX/LH SFP transceiver module for SMF and MMF, 1300-nm wavelength, commercial operating temperature range, 32°F to 158°F (0°C to 70°C)
SFP-GE-L=	Cisco 1000BASE-LX/LH SFP transceiver module for SMF and MMF, 1300-nm wavelength, extended operating temperature range, 23°F to 185°F (-5°C to 85°C)
GLC-LX-SM-RGD=	Cisco 1000BASE-LX/LH SFP transceiver module for SMF and MMF, 1300-nm wavelength, industrial operating temperature range, -40°F to 185°F (-40°C to 85°C)
X2-10GB-LX4=	Cisco 10GBASE-LX4 X2 Module for MMF, 1300-nm WWDM wavelength, commercial operating temperature range, 32°F to 158°F (0°C to 70°C)
XENPAK-10GB-LX4=	Cisco 10GBASE-LX4 XENPAK Module for MMF, 1300-nm WWDM wavelength, commercial operating temperature range, 32°F to 158°F (0°C to 70°C)
X2-10GB-LRM=	Cisco 10GBASE-LRM X2 Module for MMF, 1300-nm wavelength, commercial operating temperature range, 32°F to 158°F (0°C to 70°C)
XENPAK-10GB-LRM=	Cisco 10GBASE-LRM XENPAK Module for MMF, 1300-nm wavelength, commercial operating temperature range, 32°F to 158°F (0°C to 70°C)

Table 2 describes the MCP cables offered by Cisco. Note there are mainly two types of MCP respectively for applications over 62.5-micron MMF and 50-micron MMF.

Table 2. Mode Conditioning Patch Cables

Product Number	Product Description
CAB-GELX-625=	IEEE 802.3z-compliant optical fiber assembly consisting of a single-mode fiber permanently coupled off-center to a 62.5-micron multimode optical fiber with duplex SC connectors at both ends. The patch cord is 3 meters (9.84 feet) in length.
CAB-MCP50-SC=	IEEE 802.3z-compliant optical fiber assembly consisting of a single-mode fiber permanently coupled off-center to a 50-micron multimode optical fiber with duplex SC connectors at both ends. The patch cord is 1 meter (3.28 feet) in length.
CAB-MCP-LC=	IEEE 802.3z-compliant optical fiber assembly consisting of a single-mode fiber permanently coupled off-center to a 62.5-micron multimode optical fiber with duplex SC connectors at one end and duplex LC connectors at the other end. The patch cord is 1 meter (3.28 feet) in length.

Figure 1 shows an MCP and how it is typically connected to a transceiver module. When required, it is inserted between a transceiver module and the MMF cable plant.

Figure 1. Mode Conditioning Patch Cable Installation

Types of Multimode Fiber

Table 3 provides a brief overview and naming conventions of various MMF types deployed in the field.

For additional information about optical fibers, refer to

http://www.cisco.com/en/US/prod/collateral/modules/ps5455/white_paper_c11-463661.html.

Table 3. Types of MMF

Naming Convention	Core Size in Microns	Modal Bandwidth at 850 nm (MHz*km)	OFL Modal Bandwidth at 1310 nm (MHz*km)
FDDI-grade	62.5	160	500
OM1	62.5	200	500
OM2	50	500	500
OM3	50	1500	500

Requirements for Gigabit Ethernet Transmissions

The requirement for MCP is specified only for 1000BASE-LX/LH transceivers transmitting in the 1300-nm window and in applications over MMF. MCP should never be used in 1000BASE-SX links in the 850-nm window.

MCP is required for 1000BASE-LX/LH applications over FDDI-grade, OM1, and OM2 fiber types. MCP should never be used for applications over OM3, also known as “laser-optimized fiber.”

Notes:

1. Some customers might be tempted to connect 1000BASE-LX/LH devices over short reaches of MMF jumper cables without MCP cables. There is a risk associated to this type of nonstandard deployment, especially when the jumper cable is an FDDI-grade or OM1 type. In such case the power coupled directly into a 62.5-micron fiber could be as high as a few dBm (typically 5 to 6 dBm), and if the jumper cable is short, the adjacent receiver will be saturated, causing high bit error rate, and eventually irreversibly damaged. We recommend the use of MCP, but if the customer remains reluctant to the deployment of MCP, a 5-dB attenuator for 1300nm should be used and plugged at the transmitter of the optical module on each side of the link.
2. Another alternative for short reaches within the same location is to use a single-mode patch cable. There will be no saturation over single-mode fiber.

Requirements for 10 Gigabit Ethernet Transmissions

The requirement for MCP is specified only for 10GBASE-LX4 and 10GBASE-LRM transceivers transmitting in the 1300-nm window and in applications over MMF. MCP should never be used in 10GBASE-SR links in the 850-nm window.

MCP is required for 10GBASE-LX4 and 10GBASE-LRM applications over FDDI-grade, OM1, and OM2 fiber types. MCP should never be used for applications over OM3, also known as “laser-optimized fiber.”

Notes for LX4:

1. In some cases, customers might experience that a link would be operating properly over OM2 fiber type without MCP.
2. Some customers may be tempted to connect 10GBASE-LX4 devices over MMF jumper cables without MCP cables. This includes the case of links over OM3 cable for which the MCP should not be used. There is a risk to overload and saturate the adjacent receiver causing high bit error rate, link flaps and eventually irreversible damage. In such cases, a 5-dB attenuator for 1300nm should be used and plugged at the transmitter of the optical module on each side of the link.
3. Another alternative for short reaches within the same location is to use a single-mode patch cable. There will be no saturation over single-mode fiber. Please note the 10GBASE-LX4 devices can reach up to 10km over single-mode fiber as per compliance to IEEE.

Notes for LRM:

1. With 10GBASE-LRM interfaces, a conditioned launch is preferred for applications over FDDI-grade, OM1 and OM2. If no MCP is used, a MMF jumper cable of 2 to 5 meters long should be inserted between the transceiver and the cable plant.
2. For customers using MMF jumper cables of any type to connect 10GBASE-LRM devices without MCP or intermediate patch panels or connectors, it is preferable to measure the power level before plugging the fiber into the adjacent receiver. When the power is measured to be above 0.5dBm, a 5-dB attenuator for 1300nm should be used and plugged at the transmitter of the optical module on each side of link.
3. Another alternative for short reaches within the same location is to use a single-mode patch cable. There will be no saturation over single-mode fiber.

For More Information

For more information about the Gigabit Ethernet and 10 Gigabit Ethernet Cisco transceiver modules, visit:

- Cisco SFP data sheet:
http://www.cisco.com/en/US/prod/collateral/modules/ps5455/ps6577/product_data_sheet0900aecd8033f885.html
- Cisco GBIC data sheet:
http://www.cisco.com/en/US/prod/collateral/modules/ps5455/ps6577/product_data_sheet09186a008014cb5e.html
- Cisco X2 data sheet:
http://www.cisco.com/en/US/prod/collateral/modules/ps5455/ps6574/product_data_sheet0900aecd801f92aa.html
- Cisco XENPAK data sheet:
http://www.cisco.com/en/US/prod/collateral/modules/ps2797/ps5138/product_data_sheet09186a008007cd00_ps5455_Products_Data_Sheet.html



Americas Headquarters
Cisco Systems, Inc.
San Jose, CA

Asia Pacific Headquarters
Cisco Systems (USA) Pte. Ltd.
Singapore

Europe Headquarters
Cisco Systems International BV
Amsterdam, The Netherlands

Cisco has more than 200 offices worldwide. Addresses, phone numbers, and fax numbers are listed on the Cisco Website at www.cisco.com/go/offices.

CCDE, CCSI, CCENT, Cisco Eos, Cisco HealthPresence, the Cisco logo, Cisco Lumin, Cisco Nexus, Cisco Nurse Connect, Cisco Stackpower, Cisco StadiumVision, Cisco TelePresence, Cisco WebEx, DCE, and Welcome to the Human Network are trademarks; Changing the Way We Work, Live, Play, and Learn and Cisco Store are service marks; and Access Registrar, Aironet, AsyncOS, Bringing the Meeting To You, Catalyst, CCDA, CCDP, CCIE, CCI, CCNA, CCNP, CCSP, CCVP, Cisco, the Cisco Certified Internetwork Expert logo, Cisco IOS, Cisco Press, Cisco Systems, Cisco Systems Capital, the Cisco Systems logo, Cisco Unity, Collaboration Without Limitation, EtherFast, EtherSwitch, Event Center, Fast Step, Follow Me Browsing, FormShare, GigaDrive, HomeLink, Internet Quotient, IOS, iPhone, iQuick Study, IronPort, the IronPort logo, LightStream, Linksys, MediaTone, MeetingPlace, MeetingPlace Chime Sound, MGX, Networkers, Networking Academy, Network Registrar, PCNow, PIX, PowerPanels, ProConnect, ScriptShare, SenderBase, SMARTnet, Spectrum Expert, StackWise, The Fastest Way to Increase Your Internet Quotient, TransPath, WebEx, and the WebEx logo are registered trademarks of Cisco Systems, Inc. and/or its affiliates in the United States and certain other countries.

All other trademarks mentioned in this document or website are the property of their respective owners. The use of the word partner does not imply a partnership relationship between Cisco and any other company. (0903R)